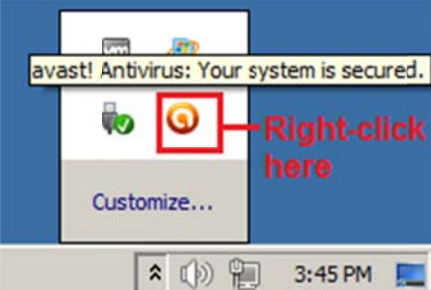
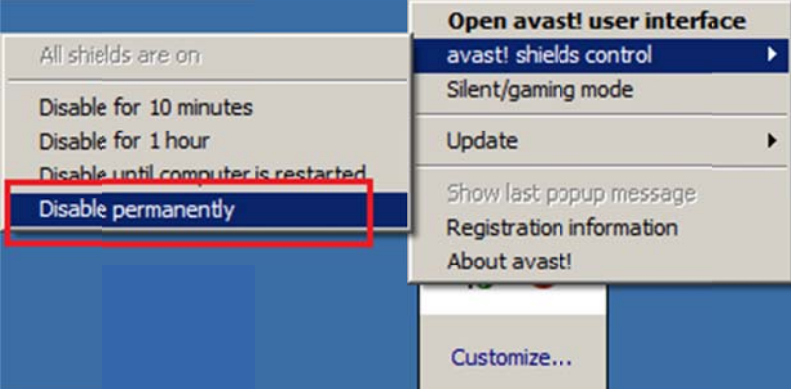
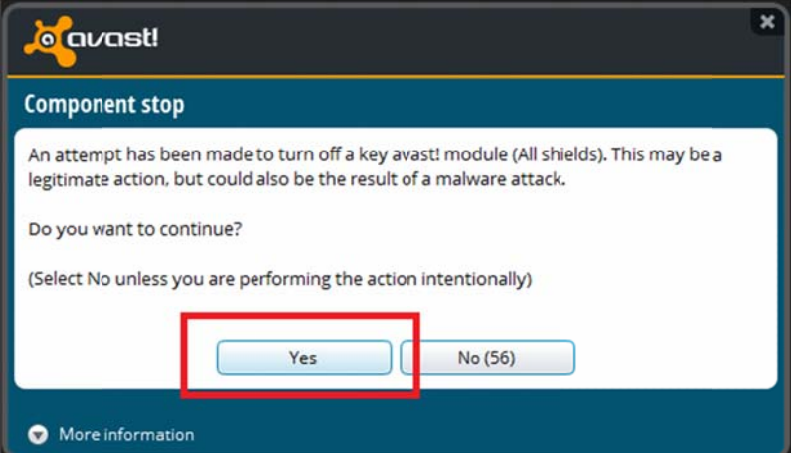


Yes. MotionWorks IEC can be recovered by restoring the quarantined application files. The MotionWorks IEC program folder should be excluded from quarantines after file restoration. The following procedure will show how to restore the quarantined files and to exclude the application.


1. Do not uninstall MotionWorks IEC. The antivirus real-time protection service will quarantine files again during reinstallation.
2. Disable Avast! Antivirus.

<p>Right-click on Avast! Antivirus icon in system tray.</p>	
<p>Navigate to avast! shields control then select Disable permanently option. (Antivirus can be re-enabled at any time.)</p>	
<p>Click Yes button in confirmation dialog.</p>	

3. Recover quarantined file "MwtPs.DLL"

<p>Open Avast! Antivirus user interface.</p>	
---	--


Select the **Maintenance** tab then click on “**Virus Chest**” menu list.

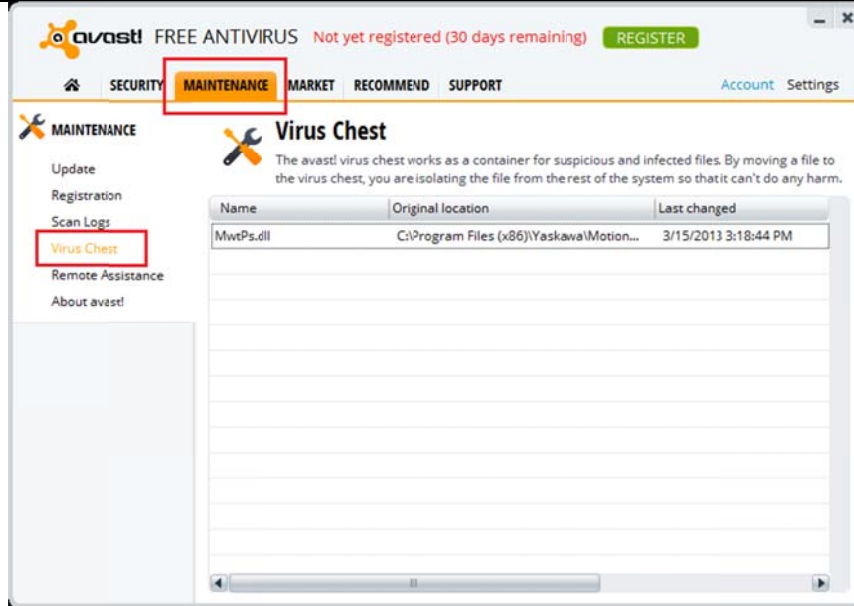


Right-click on the quarantined file and execute **Restore**.

4. White-list MotionWorks IEC installation folder locally.

Select the **Security** tab then click on **File System Shield** in menu list. Click on **Settings** button at right of tab.

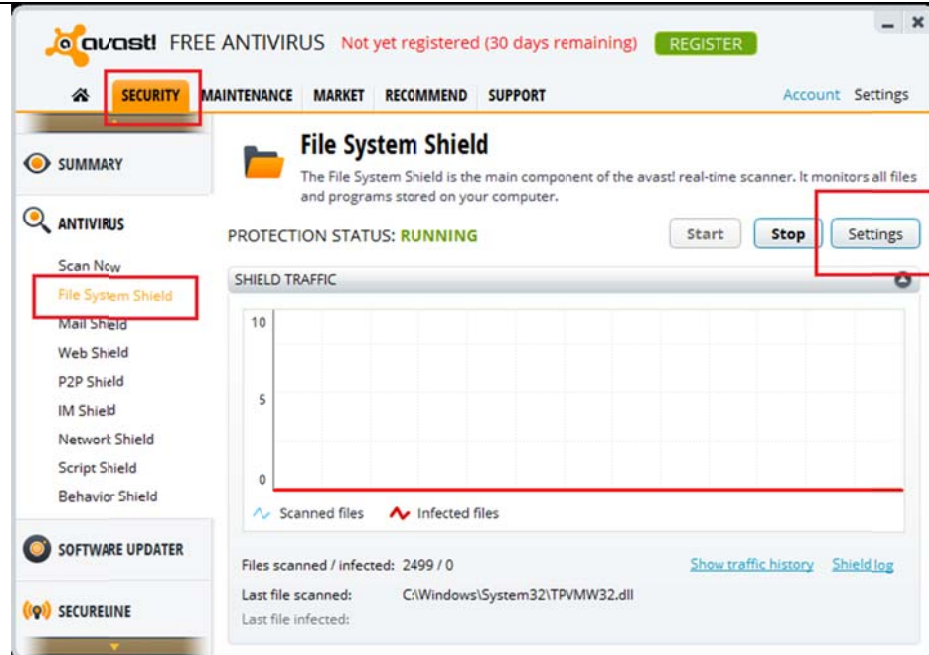

Select **Exclusions** from the menu list of the **Settings** dialog. Use the **Browse** button to input the MotionWorks IEC installation folder path. Click **OK** button to save setting.

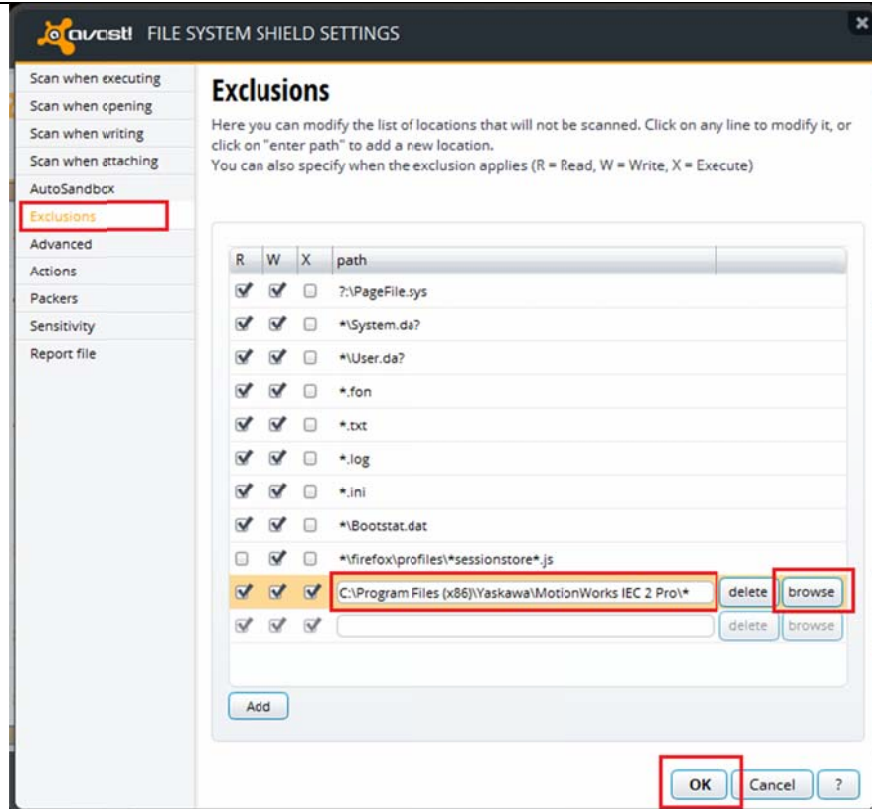

After restoring file, continue with the following steps to make sure MWiec can compile:

5. Open command prompt that is run as administrator
6. Change directory to MWIEC install folder
7. Open Task Manager to Processes tab
8. Execute "Mwt.exe /uninstall" in command prompt; wait for Mwt.exe process to complete
9. Execute "Mwt.exe /install" in command prompt; wait for Mwt.exe process to complete
10. Re-enable antivirus.